
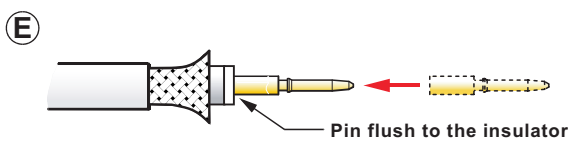
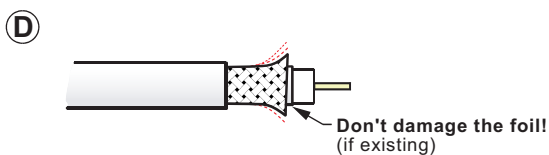
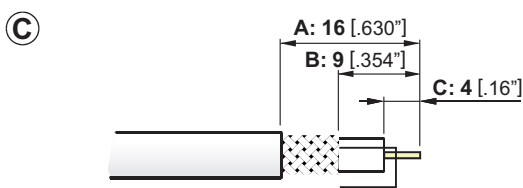


Rear Twist BNC


75Ω Cable Connector

Crimp version

Assembly Instructions

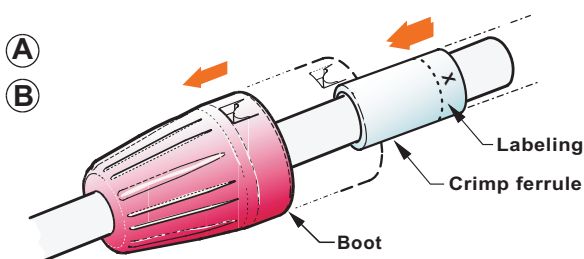


- (A) Slide the boot onto the cable**
- Position the labeling to the cable end
- (B) Slide the crimp ferrule onto the cable**
- (C) Prepare cable as shown**
- Use an adjustable coaxial cable stripper

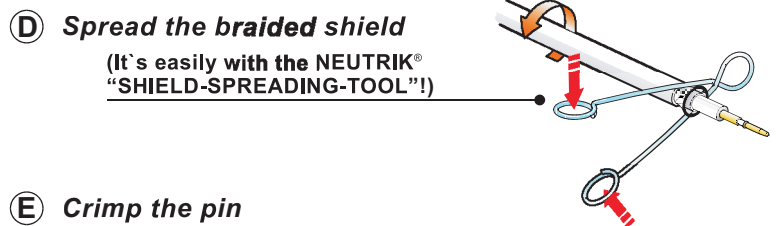

- (D) Spread the braided shield**
(It's easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!)
- (E) Crimp the pin**
- position the pin on the center conductor
- **Crimp the pin with the tool**
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
- **Pin can also be soldered (Optional)!**
- **Straighten the pin if misaligned.**

- (F) Insert the cable into the connector body**
- (G) Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.**

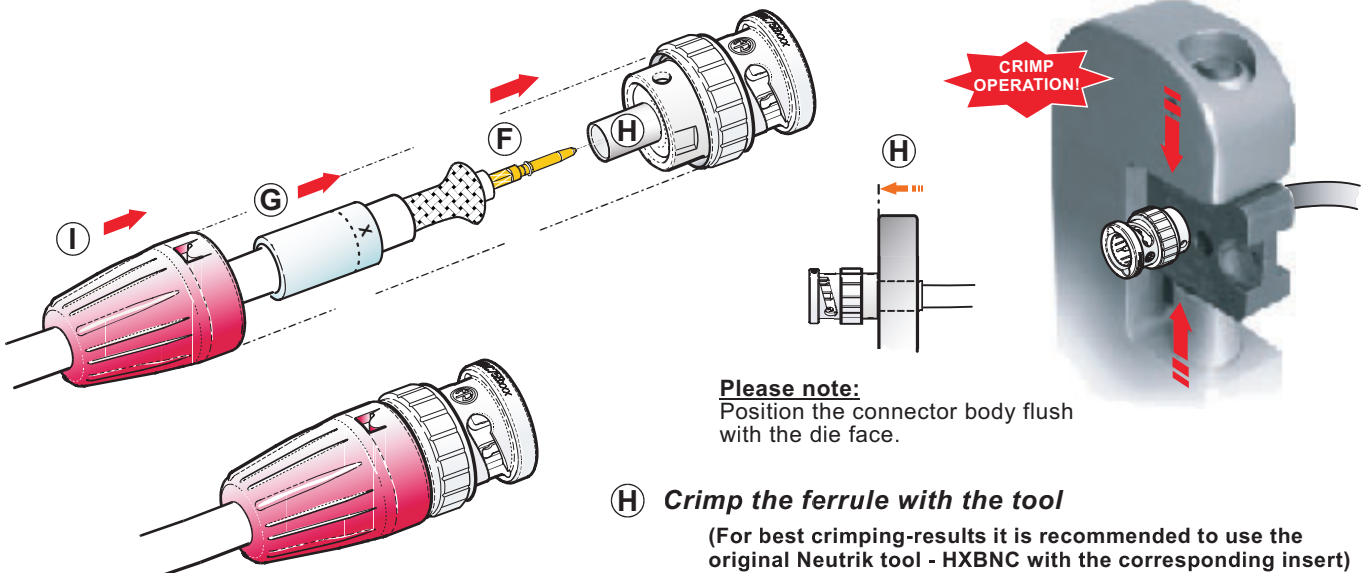

- (H) Crimp the ferrule with the tool**
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)
- (I) Snap the boot onto the connector body**

NEUTRIK AG
Liechtenstein
Tel.: +423/237 24 24
Fax: +423/232 53 93
www.neutrik.com

NEUTRIK Zürich AG
Switzerland
Tel.: +41 44/736 5010
Fax: +41 44/736 5011

NEUTRIK (UK) Ltd.
Great Britain
Tel.: +44 1983/811 441
Fax: +44 1983/811 439

NEUTRIK USA INC.
USA
Tel.: +1 732/901 9488
Fax: +1 732/901 9608

NEUTRIK Tokyo Ltd.
Japan
Tel.: +81 3/3663 4733
Fax: +81 3/3663 4796

NEUTRIK France
France
Tel.: +33 1/4131 6750
Fax: +33 1/4131 0511

NEUTRIK Vertriebs GmbH
Germany/Netherlands/Austria
Tel.: +49 8131/28 08 90
Fax: +49 8131/28 08-30

Draft. Nr.: BDA 076 / 3102M0771
Update: 06.03. 2006

Data subject to change without prior notice. ©2006 NEUTRIK®. ALL RIGHTS RESERVED.



NEUTRIK®
CONNECTING THE WORLD